


PLAN NOTES:

- ① SINCE ROOF PENETRATIONS AND MOUNTING MAY CAUSE ROOF LEAKS AND OTHER ISSUES. PLEASE MOUNT UNDER THE DRIP EDGE AND CENTER BETWEEN THE LETTERING WHERE THE SIGNS ARE LOCATED. MAKE SURE THAT THE SIGNS WILL BE ILLUMINATED WITH THE LIGHTING WHILE FLOOD LIGHTING THE BUILDING. AN "SMA" ADJUSTABLE WALL MOUNT MAY BE USED FOR TIGHT SPACES INSTEAD OF THE "W180" ADJUSTABLE WALL MOUNT. MOUNTING SHALL BE PER THE CONTRACTOR'S DISCRETION. TYPICAL MOUNTING IS WITH THE "W180" ADJUSTABLE WALL MOUNT TO OBTAIN THE BEST PHOTOMETRIC SPREAD OVER THE BUILDING.
- ② A SINGLE POWER PACK SHOULD BE ABLE TO CONTROL UP TO 20FT OF LIGHTING AT 48V DC. FOR LONGER RUNS PLAN ON PLACING MULTIPLE POWER PACKS. THE POWER PACKS MAY BE UP TO 30FT AWAY- WHICH THEY MAY BE PLACED INDOORS.
- ③ PAINT ALL EXTERIOR CONDUITS AND JUNCTION BOXES TO MATCH EXISTING CONDITIONS. SINCE EXTERIOR CONDUITS AT THIS LEVEL CAN BE PVC, PLEASE PAINT WITH KRYLON OR EQUIVALENT PAINT THAT WILL BOND TO THE PVC AND WILL NOT FLAKE. COLOR MATCHING SHOULD BE DONE PRIOR TO PAINTING. THE PAINTING SHOULD MEET MANATEE COUNTY REQUIREMENTS.
- ④ MOUNTING SHOULD BE DONE PER THE MANUFACTURER. MAKE SURE THAT ANY AND ALL PENETRATIONS ARE SEALED PROPERLY AND DO NOT LEAK. DO NOT MOUNT FIXTURE ON THE NEW SIGN.
- ⑤ THE LIGHTING WILL BE A CONTINUOUS RUN OF MULTIPLE FIXTURES ACROSS THE AREA NOT JUST SINGLE LUMINARIES SPACED OUT.

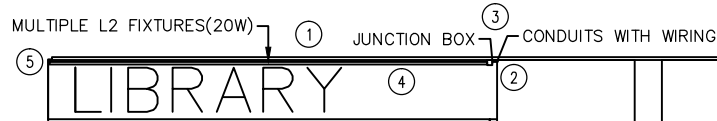

1
EX1

FIXTURE MOUNTING SECTION - NORTH SIDE WITH NEW SIGNAGE

NOT TO SCALE



2
EX1

FIXTURE MOUNTING SECTION - EAST SIDE WITH NEW SIGNAGE

NOT TO SCALE

SEAL

MATTHEW J. CAMDEN
FL#79284

ATP ENGINEERING SOUTH, FL
BRADENTON, FL 34205
ENGR BUSINESS 8888
941-778-6468

MANATEE COUNTY
ADMINISTRATOR
RESPONSE TO MOUNTING QUESTIONS

MANATEE COUNTY CENTRAL LIBRARY
EXTERIOR SITE LIGHTING
1301 1ST AVE W.
BRADENTON, FLORIDA 34205
WORK ASSIGNMENT 160 CO#1

PROJECT NO. 2014-48
FILE# MC CENTRAL LIBRARY
JOB NO. 2014-48
DATE: 05/12/2016
PLOT SIZE: 8.5"x11"
DRAWN BY: CMD/MC
CHECKED BY: JDC
SHEET NO. EX1